



E282

DORMER

- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

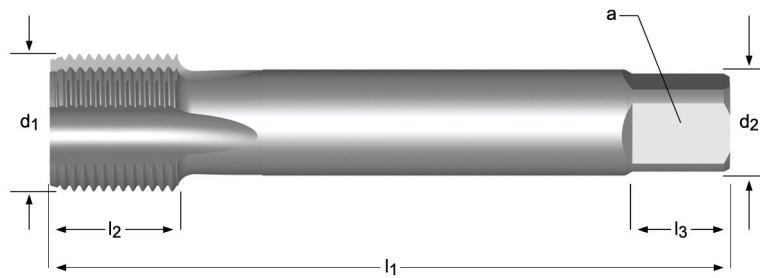

E282



- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 6.2 6.3 7.2 7.3 8.2

G(BSP)	TPI	d ₁ nom mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z		e-Code
1/8	28	9,73	90	20	7	5,5	8	3	8.8	E2821/8
1/4	19	13,16	100	21	11	9,0	12	4	11.8	E2821/4
3/8	19	16,66	100	21	12	9,0	12	4	15.25	E2823/8
1/2	14	20,96	125	24	16	12,0	15	4	19	E2821/2
5/8	14	22,91	125	24	18	14,5	17	4	21	E2825/8
3/4	14	26,44	140	28	20	16,0	19	4	24.5	E2823/4
7/8	14	30,20	150	26	22	18,0	21	4	28.25	E2827/8
1	11	33,25	160	30	25	20,0	23	4	30.75	E2821
1.1/8	11	37,90	170	28	28	22,0	25	4	35	E2821.1/8
1.1/4	11	41,91	170	30	32	24,0	27	4	39.5	E2821.1/4
1.1/2	11	47,80	190	32	36	29,0	32	6	45	E2821.1/2