



E422 - E423

DORMER

- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

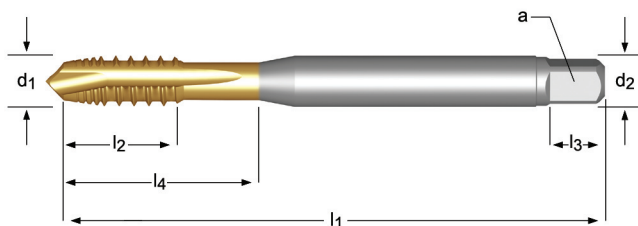


E422




- 1.2 1.3 1.4
- 1.1 1.5 3.1 3.2 3.3 3.4 4.1 4.3 5.1 5.2 6.1 6.2 6.3 7.1 7.2 7.3 7.4 8.1

M	P mm	l_1 mm	l_2 mm	d_2 Ø mm	\square a mm	l_3 mm	z		l_4 mm	e-Code
3	0,50	56	9	3,5	2,7	6	3	2.5	18	E422M3
4	0,70	63	12	4,5	3,4	6	3	3.3	21	E422M4
5	0,80	70	13	6,0	4,9	8	3	4.2	25	E422M5
6	1,00	80	15	6,0	4,9	8	3	5	30	E422M6
8	1,25	90	18	8,0	6,2	9	3	6.8	35	E422M8
10	1,50	100	20	10,0	8,0	11	3	8.5	39	E422M10

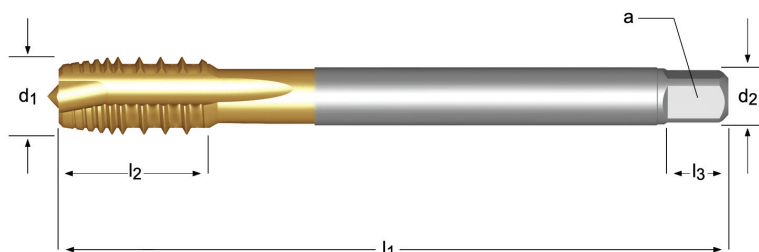

E423



- 1.2 1.3 1.4
- 1.1 1.5 3.1 3.2 3.3 3.4 4.1 4.3 5.1 5.2 6.1 6.2 6.3 7.1 7.2 7.3 7.4 8.1

M	P mm	l_1 mm	l_2 mm	d_2 Ø mm	\square a mm	l_3 mm	z		e-Code
12	1,75	110	23	9	7,0	10	3	10.3	E423M12
14	2,00	110	25	11	9,0	12	3	12	E423M14
16	2,00	110	25	12	9,0	12	3	14	E423M16
18	2,50	125	30	14	11,0	14	3	15.5	E423M18
20	2,50	140	30	16	12,0	15	3	17.5	E423M20
22	2,50	140	34	18	14,5	17	4	19.5	E423M22
24	3,00	160	38	18	14,5	17	4	21	E423M24