



E229

DORMER

- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

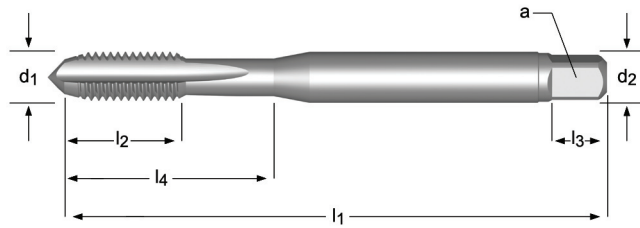

E229



- 1.1 1.2 1.3 1.4 1.5 3.1 3.2 3.3 6.2 6.3 7.2 7.3 8.2

| UNF | TPI | d ₁ nom mm | l ₁ mm | l ₂ mm | d ₂ Ø mm | ∟ a mm | l ₃ mm | z | | l ₄ mm | e-Code |
|-----|-----|-----------------------------|----------------------|----------------------|---------------------------|--------------|----------------------|---|------|----------------------|-----------|
| 2 | 64 | 2,184 | 45 | 7 | 2,8 | 2,1 | 5 | 3 | 1.9 | 12 | E2292-64 |
| 3 | 56 | 2,515 | 50 | 8 | 2,8 | 2,1 | 5 | 3 | 2.15 | 12,5 | E2293-56 |
| 4 | 48 | 2,845 | 56 | 9 | 3,5 | 2,7 | 6 | 3 | 2.4 | 18 | E2294-48 |
| 5 | 44 | 3,175 | 56 | 10 | 3,5 | 2,7 | 6 | 3 | 2.7 | 18 | E2295-44 |
| 6 | 40 | 3,505 | 56 | 11 | 4,0 | 3,0 | 6 | 3 | 2.95 | 20 | E2296-40 |
| 8 | 36 | 4,166 | 63 | 12 | 4,5 | 3,4 | 6 | 3 | 3.5 | 21 | E2298-36 |
| 10 | 32 | 4,826 | 70 | 13 | 6,0 | 4,9 | 8 | 3 | 4.1 | 25 | E22910-32 |
| 12 | 28 | 5,486 | 80 | 15 | 6,0 | 4,9 | 8 | 3 | 4.7 | 30 | E22912-28 |
| 1/4 | 28 | 6,350 | 80 | 16 | 7,0 | 5,5 | 8 | 3 | 5.5 | 30 | E2291/4 |