



- Machine Taps
- Tarauds machine

- Maschinen-Gewindebohrer
- Machos de máquina

- Machinetappen
- Macho de Máquina

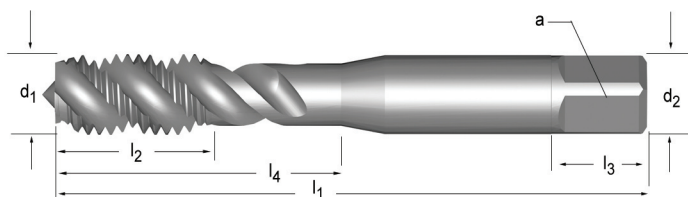

## E533



- 1.2 1.3 1.4 2.1 2.2 2.3
- 5.2 7.1 7.2 7.3 7.4

BSW	TPI	d <sub>1</sub> nom mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> Ø mm	□ a mm	z	↔	l <sub>4</sub> mm	e-Code
1/8	40	3,175	48	12,5	3,15	2,50	3	2.55	12,5	E5331/8
1/8	40	3,175	48	12,5	3,15	2,50	3	2.55	12,5	E5331/8BLUE
3/16	24	4,763	58	11	5,00	4,00	3	3.7	20	E5333/16
3/16	24	4,763	58	11	5,00	4,00	3	3.7	20	E5333/16BLUE
1/4	20	6,350	66	13	6,30	5,00	3	5.1	26	E5331/4
1/4	20	6,350	66	13	6,30	5,00	3	5.1	26	E5331/4BLUE
5/16	18	7,938	72	16	8,00	6,30	3	6.5	31	E5335/16
5/16	18	7,938	72	16	8,00	6,30	3	6.5	31	E5335/16BLUE
3/8	16	9,525	80	18	10,00	8,00	3	7.9	34	E5333/8
3/8	16	9,525	80	18	10,00	8,00	3	7.9	34	E5333/8BLUE
1/2	12	12,700	89	22	9,00	7,10	3	10.5		E5331/2
1/2	12	12,700	89	22	9,00	7,10	3	10.5		E5331/2BLUE
5/8	11	15,875	102	24	12,50	10,00	3	13.5		E5335/8
5/8	11	15,875	102	24	12,50	10,00	3	13.5		E5335/8BLUE
3/4	10	19,050	112	29	14,00	11,20	3	1.5		E5333/4
3/4	10	19,050	112	29	14,00	11,20	3	1.5		E5333/4BLUE