



- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

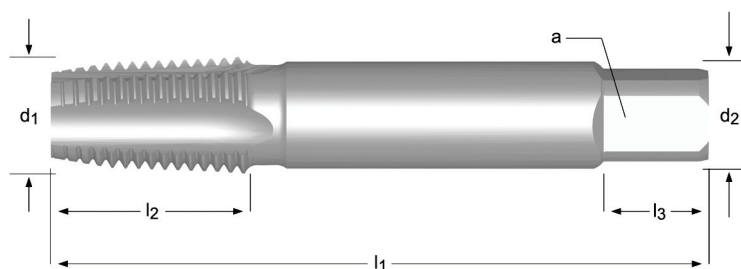

## E550



- 3.1 3.2 3.3 3.4 6.1
- 1.1 1.2 1.3 1.4 1.5 1.6 2.1 2.2 2.3 6.2 6.3 6.4 7.2 7.3 7.4 8.2 8.3

Rc	TPI	d <sub>1</sub> nom mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> ∅ mm	∠ a mm	l <sub>3</sub> mm	z		e-Code
1/8	28	9,728	59	15	8,0	6,3	9	3	8.4	E5501/8
1/8	28	9,728	59	15	8,0	6,3	9	3	8.4	E5501/8NO7
1/4	19	13,157	67	19	10,0	8,0	11	3	11.2	E5501/4
1/4	19	13,157	67	19	10,0	8,0	11	3	11.2	E5501/4NO7
3/8	19	16,662	75	21	12,5	10,0	13	3	14.75	E5503/8
3/8	19	16,662	75	21	12,5	10,0	13	3	14.75	E5503/8NO7
1/2	14	20,955	87	26	16,0	12,5	16	5	18.25	E5501/2
1/2	14	20,955	87	26	16,0	12,5	16	5	18.25	E5501/2NO7
3/4	14	26,441	96	28	20,0	16,0	20	5	23.75	E5503/4
3/4	14	26,441	96	28	20,0	16,0	20	5	23.75	E5503/4NO7
1	11	33,249	109	33	25,0	20,0	24	5	30	E5501
1.1/4	11	41,910	119	36	31,5	25,0	28	5	38.5	E5501.1/4
1.1/2	11	47,803	125	37	35,5	28,0	31	7	44.5	E5501.1/2
2.	11	59,614	140	41	40,0	31,5	34	7	56	E5502