



- Machine Taps
- Maschinen-Gewindebohrer
- Machinetappen
- Tarauds machine
- Machos de máquina
- Macho de Máquina

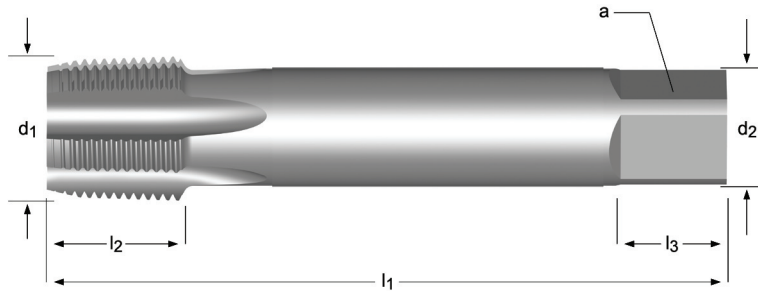

## E714



- 1.3 1.4
- 1.1 1.2 1.5 3.1 3.2 3.3 3.4 6.2 7.3 7.4 8.1

NPT	TPI	d <sub>1</sub> nom mm	l <sub>1</sub> mm	l <sub>2</sub> mm	d <sub>2</sub> Ø mm	∠ a mm	l <sub>3</sub> mm	z		e-Code
1/8	27	10,23	90	14	11,0	9,0	12	3	8.5	E7141/8
1/4	18	13,60	100	20	14,0	11,0	14	3	11	E7141/4
3/8	18	17,04	110	20	16,0	12,0	15	4	14.5	E7143/8
1/2	14	21,20	125	26	18,0	14,5	17	4	18	E7141/2
3/4	14	26,54	140	26	22,0	18,0	21	5	23	E7143/4
1.	11.5	33,20	150	31	28,0	22,0	25	5	29	E7141